

Relation between toughness, infinite fatigue life and microstructure in large blooms for automotive plastic molds.

Original

Relation between toughness, infinite fatigue life and microstructure in large blooms for automotive plastic molds / Firrao, Donato; Matteis, Paolo; Pinasco, M. R.; Stagno, E.; Gerosa, R.; Rivolta, B.; Silva, G.; Ghidini, A.. - (2005).

Availability:

This version is available at: 11583/1667876 since:

Publisher:

Published

DOI:

Terms of use:

openAccess

This article is made available under terms and conditions as specified in the corresponding bibliographic description in the repository

Publisher copyright

(Article begins on next page)

RELATION BETWEEN TOUGHNESS, INFINITE FATIGUE LIFE AND MICROSTRUCTURE IN LARGE BLOOMS FOR AUTOMOTIVE PLASTIC MOLDS.



POLITECNICO DI TORINO



D. Firrao, P. Matteis

Dip. di Sc. dei Materiali e Ing. Chimica - Politecnico di Torino

M.R. Pinasco, E. Stagno

Dip. Chimica e Chimica Industriale - Università di Genova



Università degli Studi di Genova

via Balbi, 5 - 16126 Genova
tel. +39 01020991 fax +39 0102099227 P IVA 00754150100



POLITECNICO
DI MILANO

R. Gerosa, B. Rivolta, G. Silva



Dip. Meccanica - Politecnico di Milano

A. Ghidini

Lucchini Sidermeccanica S.p.A.

GRUPPO LUCCHINI

Overall views of a bumper mold.

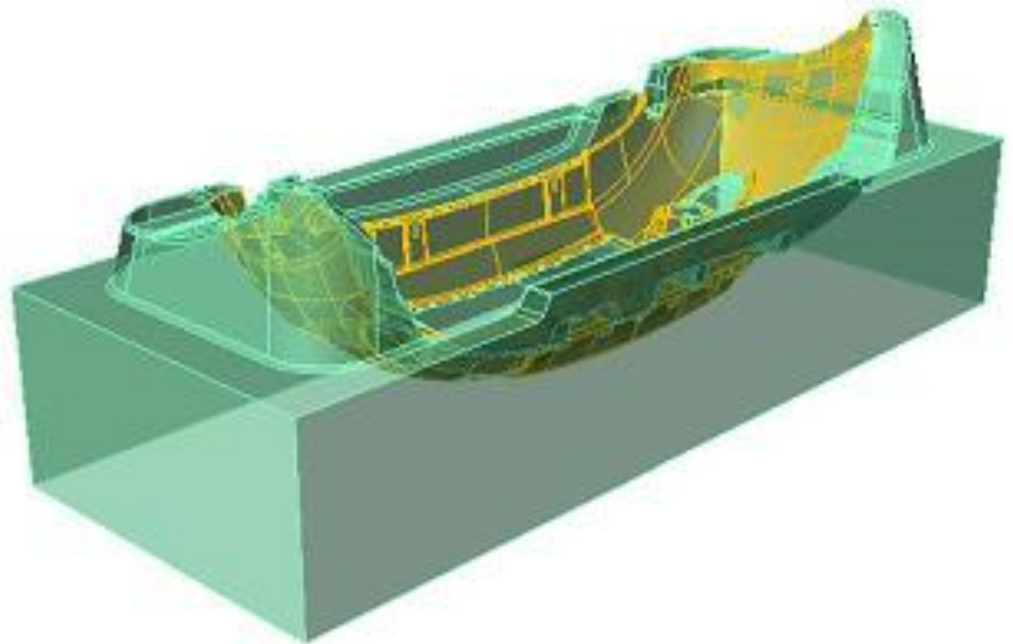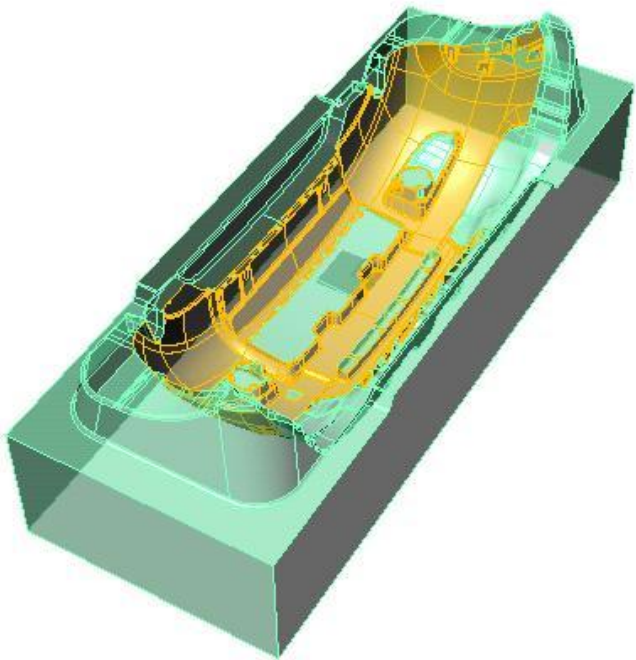

Plastic molds machined from 1x1x3 m forged and pre-hardened steel blooms

Applications

- ***automotive components (bumpers, dashboards, ...)***

Stresses

- ***applied stresses:***
 - injection pressure
 - thermal gradients
 - notch effects
 - wear by reinforced resins flow
 - fatigue: millions of pieces
- ***stresses raised by:***
 - cracks (improper weld bed depositions),
 - abnormal operations (incomplete extraction).

- ***Experience-based design, no usual defect-allowance calculation procedure***
- ***Reported macroscopically brittle in-service failures***

- ***different microstructures expected at increasing depths after quench***
- ***any microstructure could be found at mold face***

Usual Production cycle

➤ *Steel composition*

	C	Cr	Mn	Ni	Mo	Si	S	P
1.2738	0.35	1.8	1.3	0.9	0.15	0.2	<0.03	<0.03
40CrMnNiMo8-6-4	0.45	2.1	1.6	1.2	0.25	0.4		
Examined bloom	0.42	2.0	1.5	1.1	0.21	0,37	0.002	0.006

➤ *Steel mill operations*

ingot casting (ESR refining is not possible)
forging to 1x1 m sections
dehydrogenization
oil quenching
tempering (one or more stages)

➤ *Commercial warehouse operations*

removal of rough and decarburized surfaces (up to 10-20 mm)
sawing to requested dimensions


➤ *Mold machining shop operations*

chip-removal and/or electrical-discharge machining to the mold shape, grinding
with or without polishing in selected areas
local surface treatments
eventual corrections using weld bed depositions

Usual Production cycle (cont.)

Forging

- comparable ingot and bloom section
- some repeated forging steps

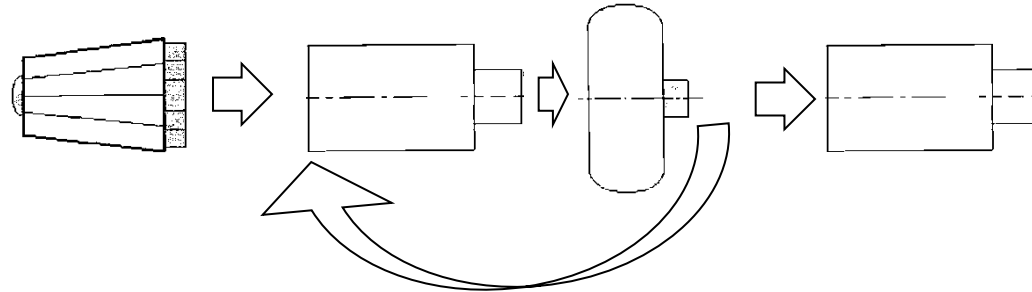



- total reduction ratio much lower than in rolling (and not comparable)

Heat treating in air



Step	Temperature	Duration
hydrogen removal		a few days
austenitizing	840-880°C	1-2 days
oil quench	-	-
tempering to 330-300 HB (two stages)	550-600°C	1-2 days (each stage)

Sampling


Forged & heat-treated surfaces

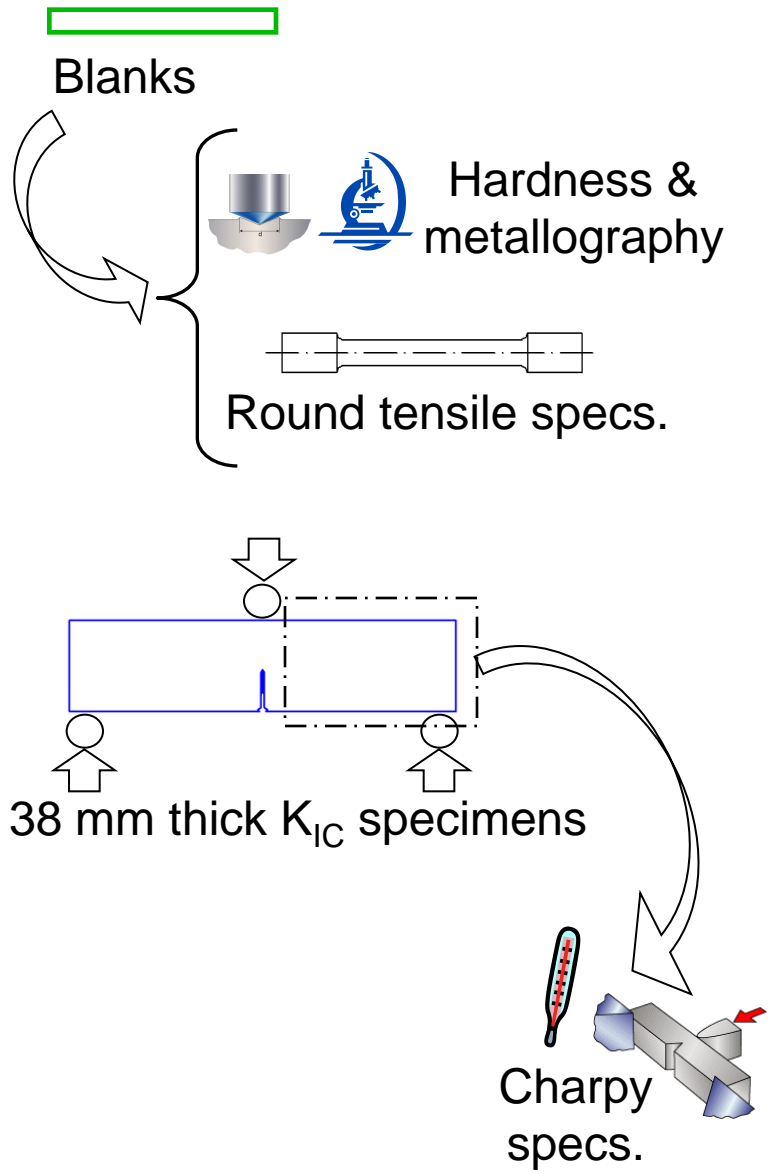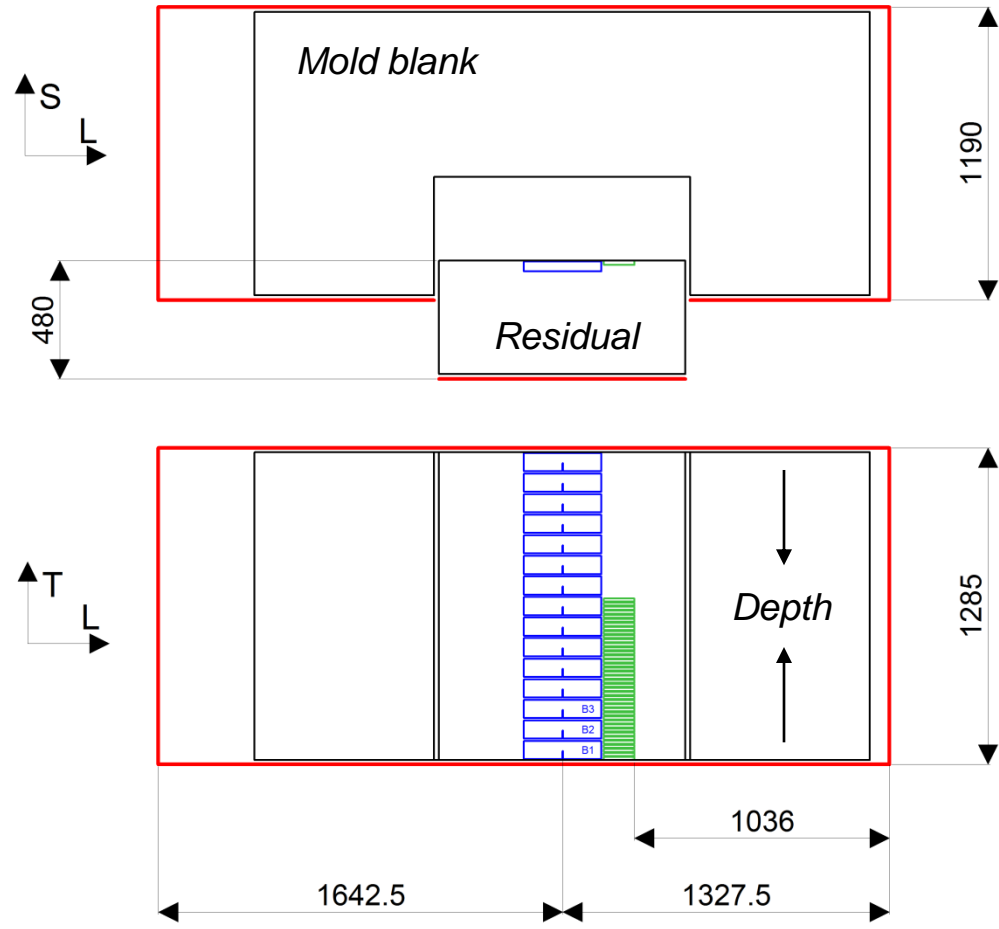


Sampling (cont.): fatigue specimens

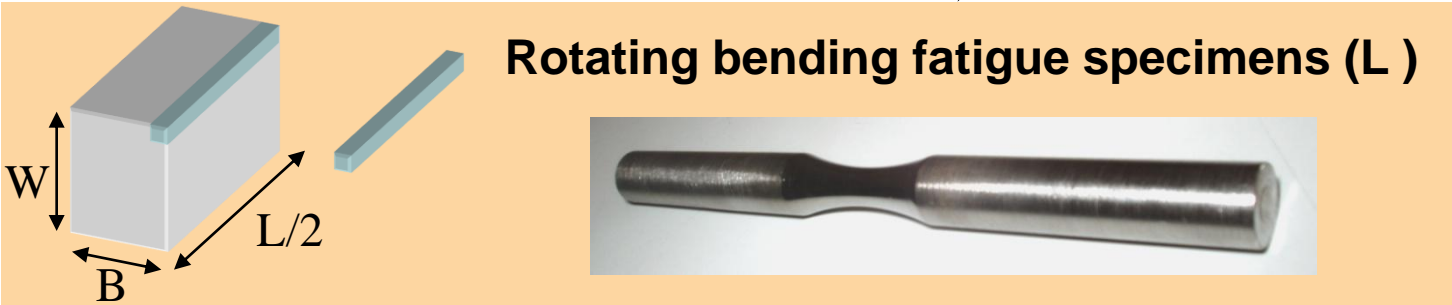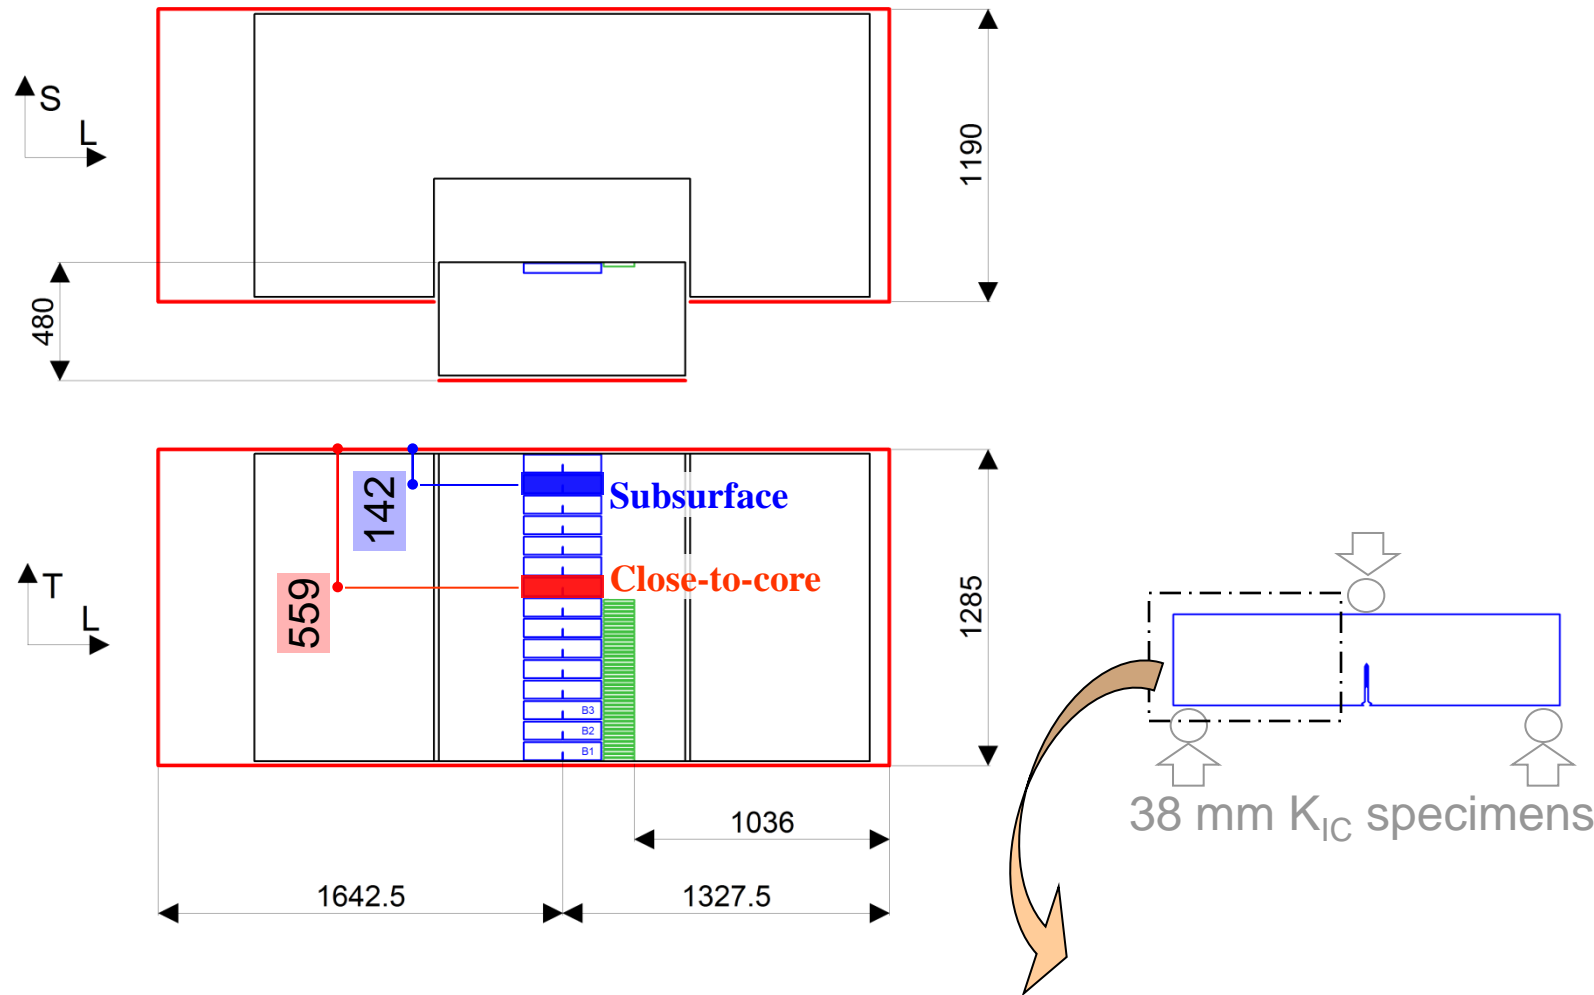


Metallography – microstructures vs. depth (Nital etch)

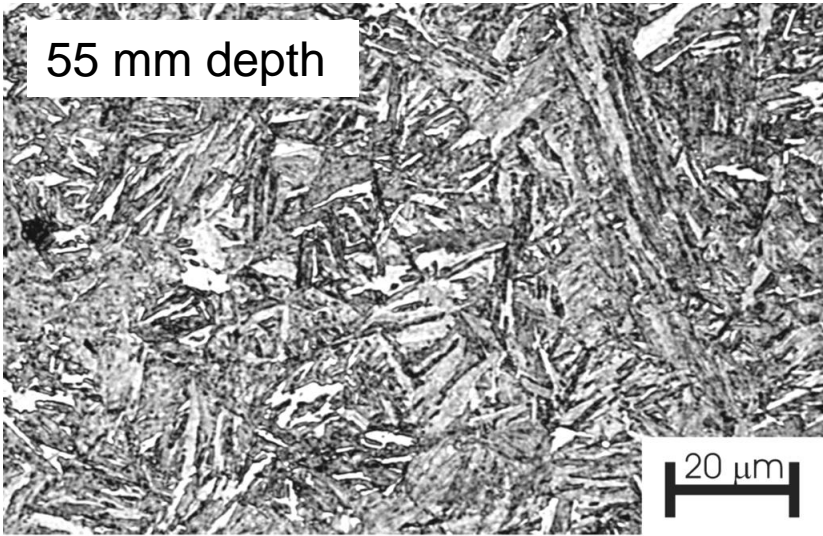


Tempered martensite, retained austenite transformed during tempering.

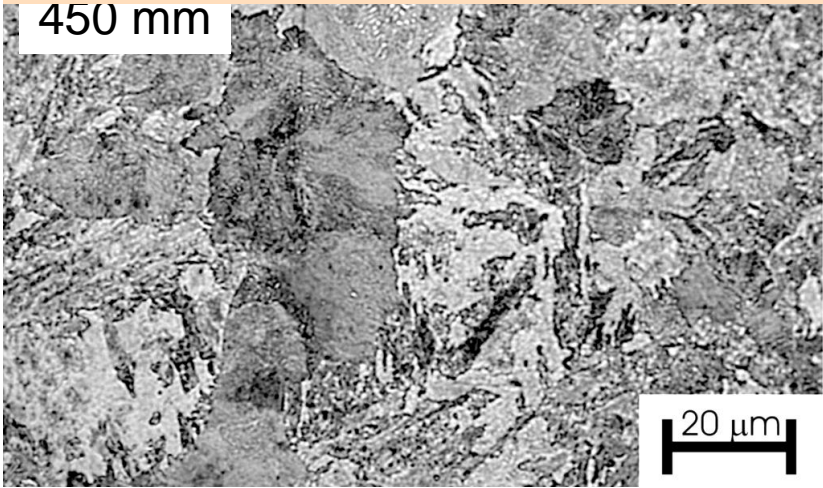

Fine and ultra-fine pearlite, upper bainite modified by tempering

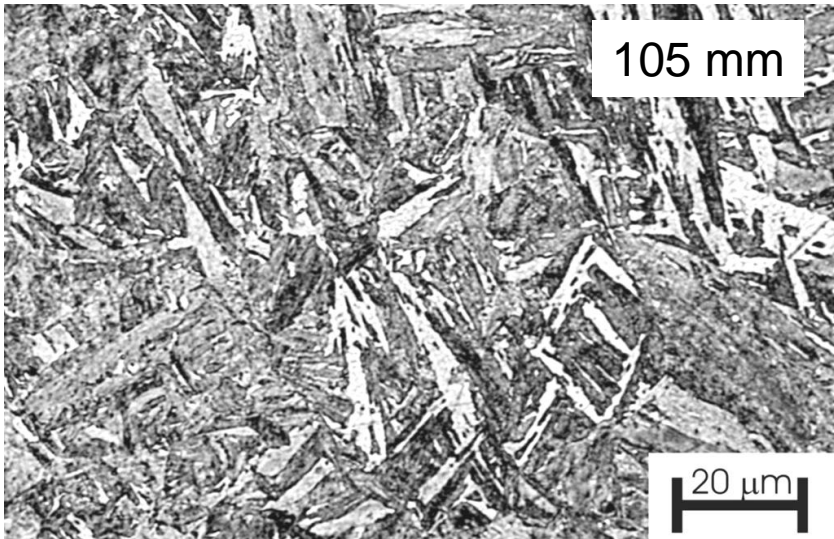


Lower bainite modified by tempering, retained austenite transformed during tempering

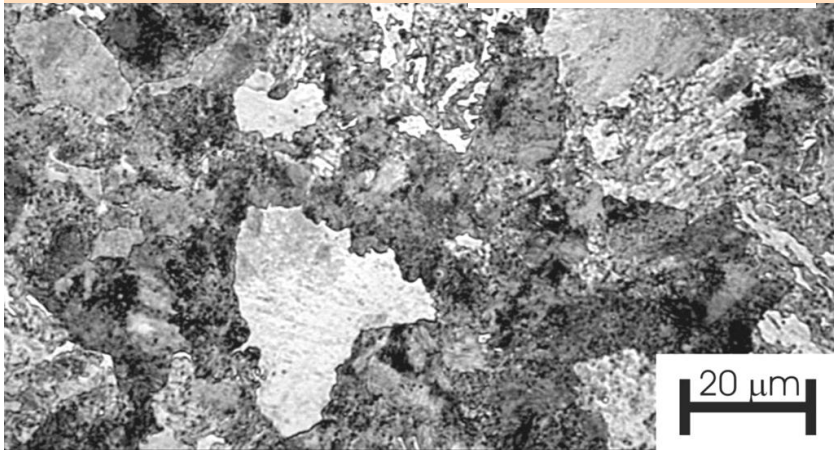

Fine pearlite, upper bainite modified by tempering

Mechanical properties: hardness, tension, fracture toughness

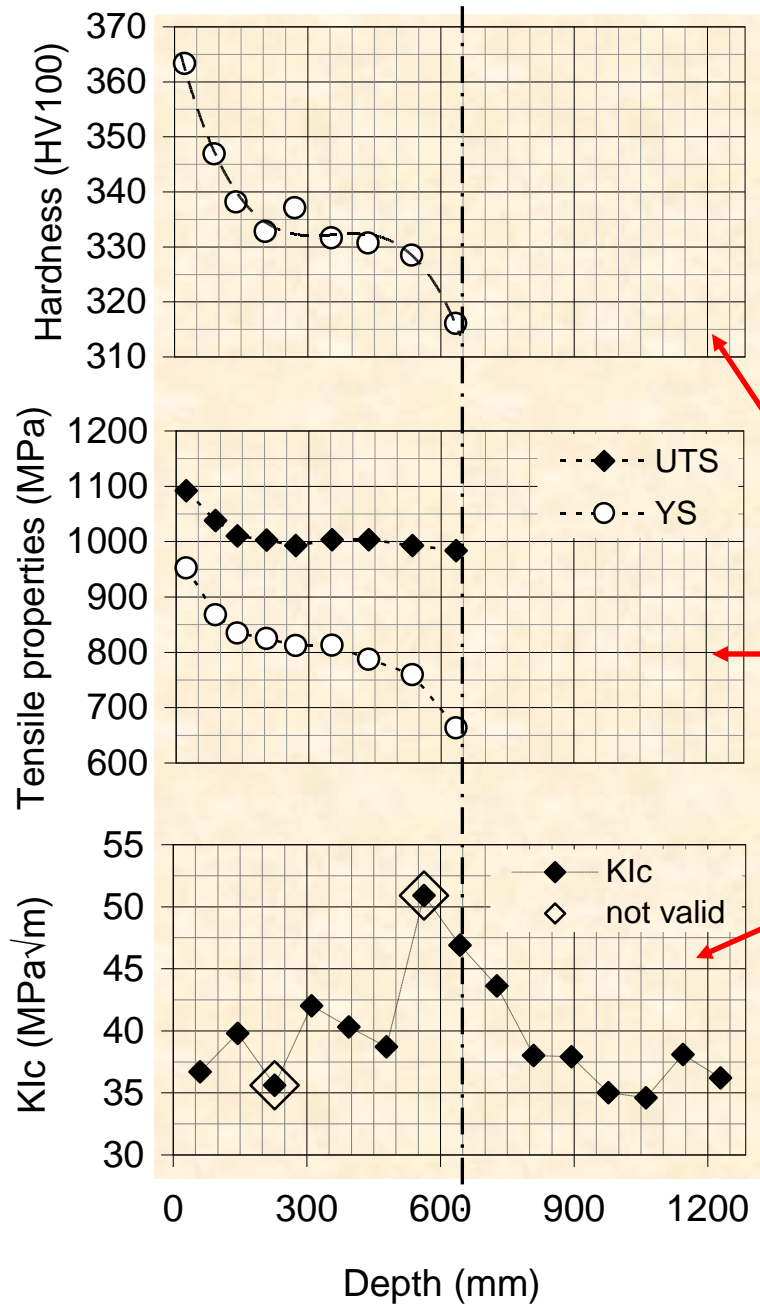



Charpy KV impact absorbed energy
50% FATT: Core 150°C - Surface 270°C

Hardness decreases from surface to core.

Tensile properties are adequate at the surface and decrease markedly at core (esp. YS).

Fracture toughness values are rather low.

Metallography: microstructures at chosen positions (Nital etch)

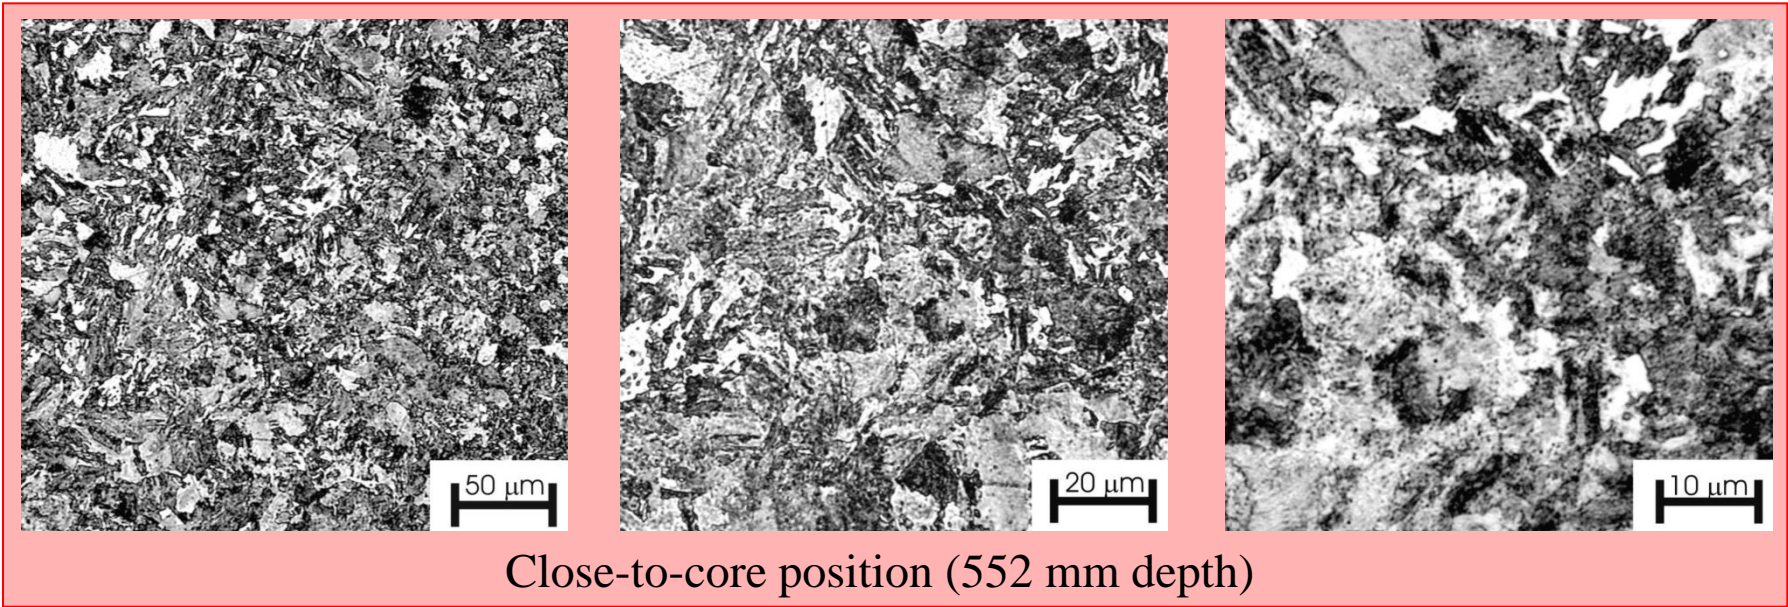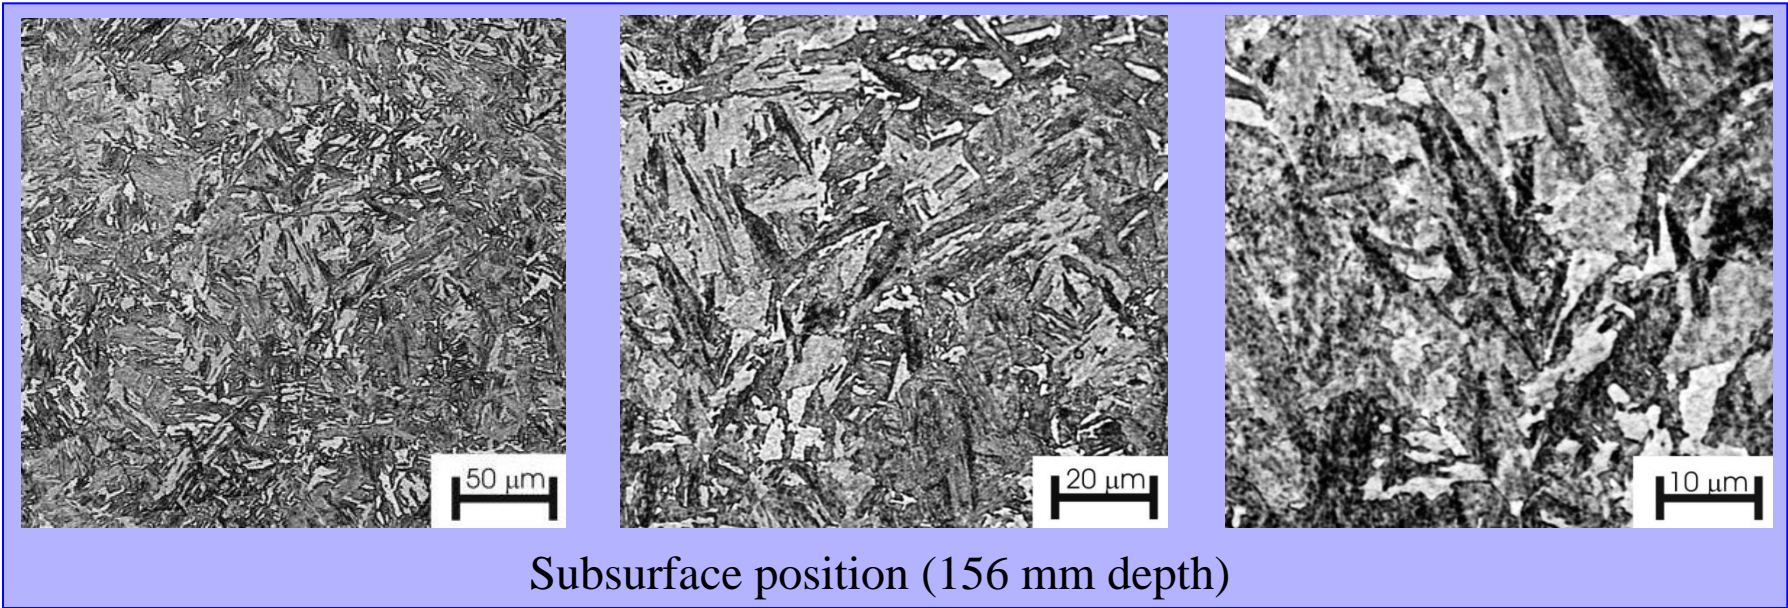


Metallography: subsurface microstructure – detail (Nital etch)

Tempered martensite

Lower bainite modified by tempering

Retained austenite with finely
scattered dark carbides due to its
transformation during tempering

Pearlite is completely absent.

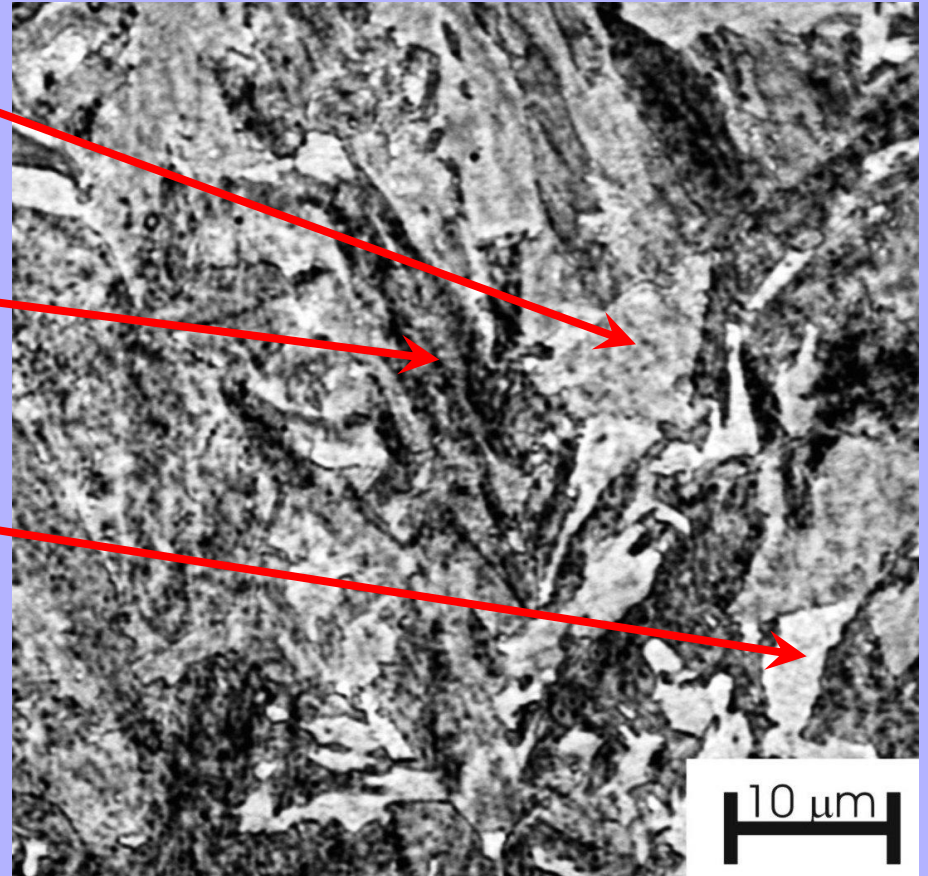


Metallography: close-to-core microstructure – detail (Nital etch)

Fine and ultra-fine pearlite


Upper bainite, modified and
subjected to carbide coarsening
during the tempering stages

(lightly attached upper bainite)

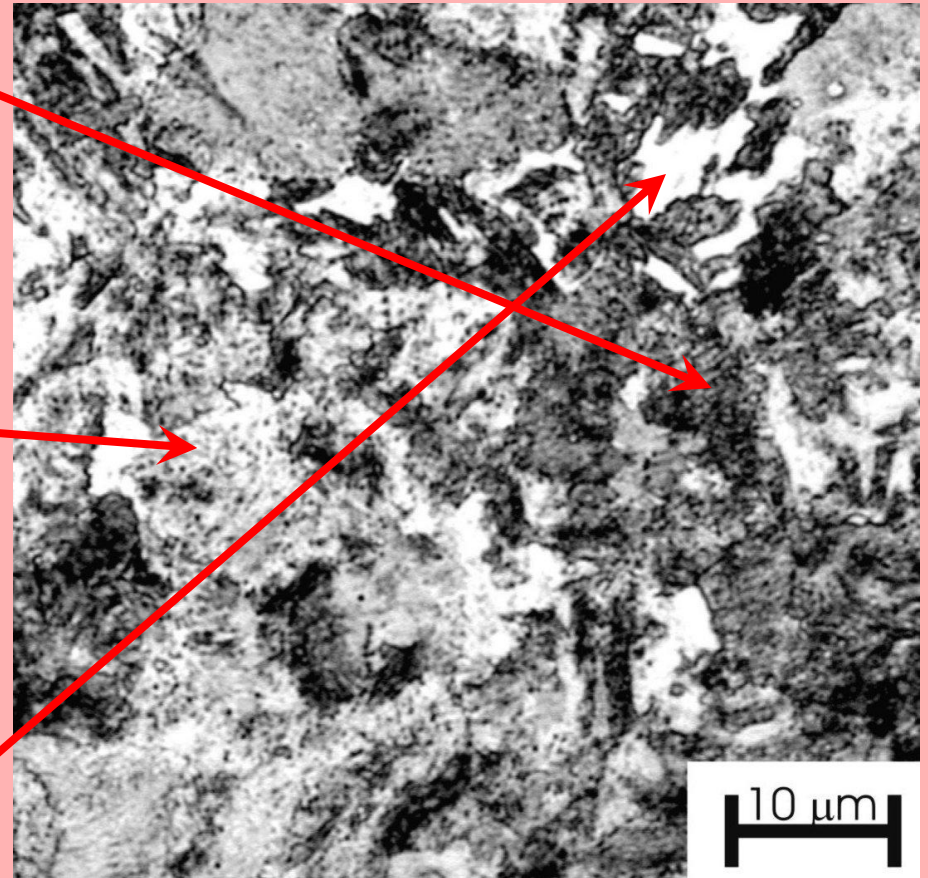

Rotating Bending Fatigue

- All samples have been machined from the two halves of two broken K_{Ic} samples, one near the surface (B14) and the other next to the core (B9).

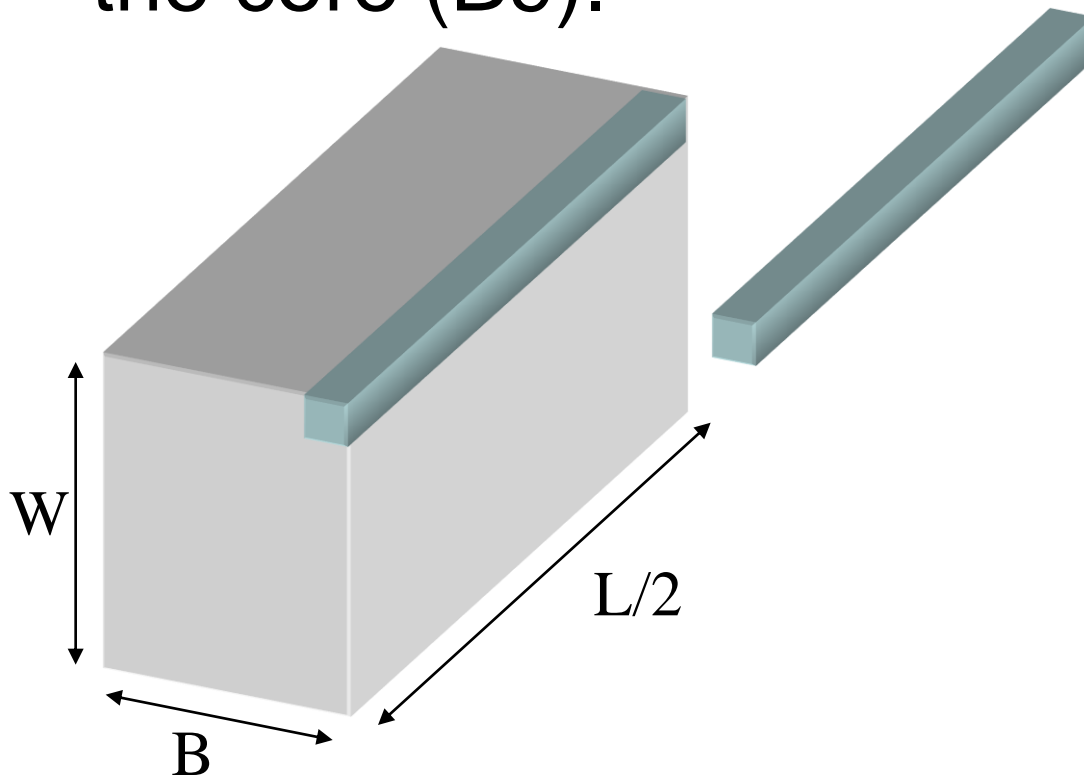

$D_{\min (nom)} = 6 \text{ mm}$

Rotating Bending Fatigue

For each of the two broken K_{Ic} samples, **two different conditions** have been investigated:

- Samples from two halves were tested in the **original condition** (B9 and B14);
- Samples from the other two halves were tested after **air quenching and double tempering** (B9T and B14T). Austenitization was carried out at about 860°C for *45 minutes*, the first tempering at 590°C for *3 hours* and the second at 550°C for *3 hours*.

Rotating Bending Fatigue

σ_D values were calculated according to the staircase method (UNI-3964); the maximum number of cycles was assumed at $4.2 \cdot 10^6$ (frequency = 50 Hz). Here follows an example.

Test n.	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15
σ [MPa]															
540															
530															
520															
510															
500								x				x			
490							o		x		o		x		
480						o				o				x	
470			x		o										o
460		o		o											
450	o														
440															

o = test passed

x = test failed


Rotating Bending Fatigue Limits

-Results-

	Depth [mm]	σ_D (50%) [MPa]
B9	625	493
B9T	625	618
B14	181	559
B14T	181	700

- The material near the surface has a better fatigue behaviour than the one next to core
- Re-heat treatment highly improves the fatigue limit (25%)


Fractography (As-received specs.)

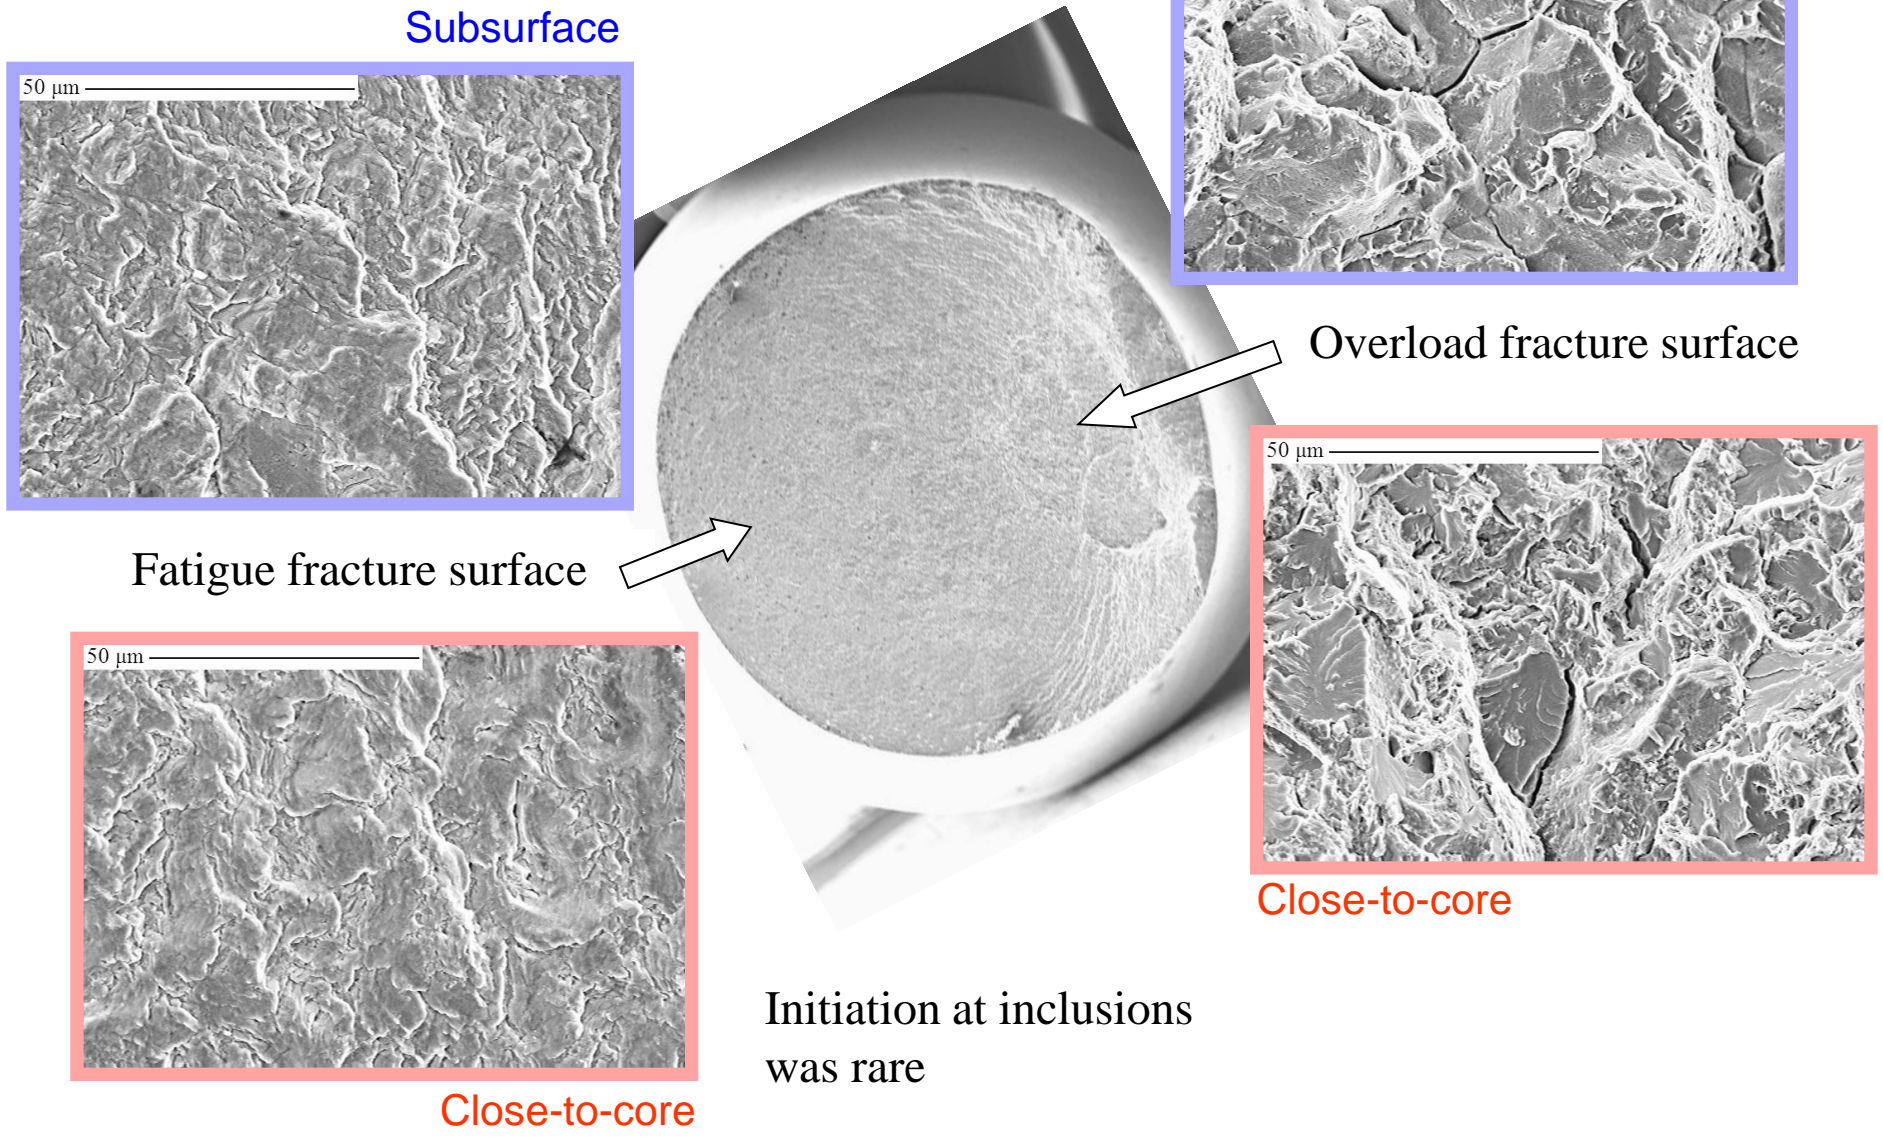


Fractography: fatigue areas

As-received



Subsurface

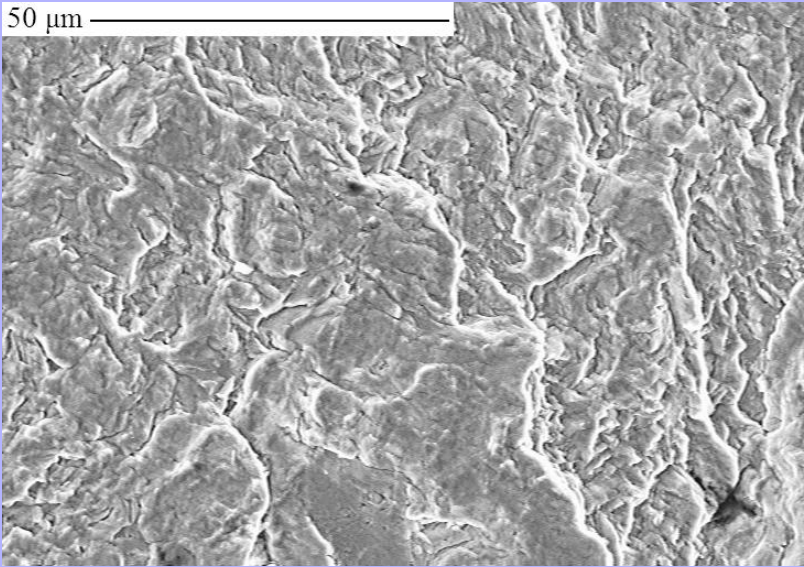

Close-to-core

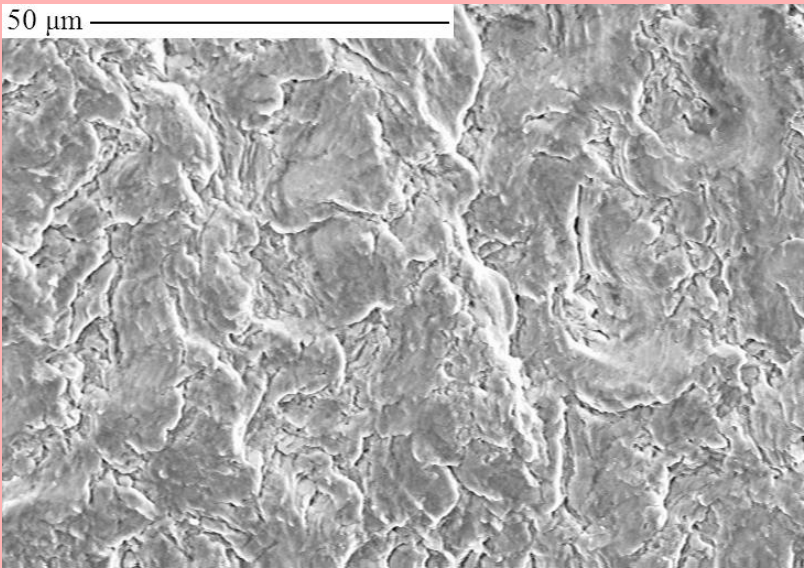

Re-heat-treated

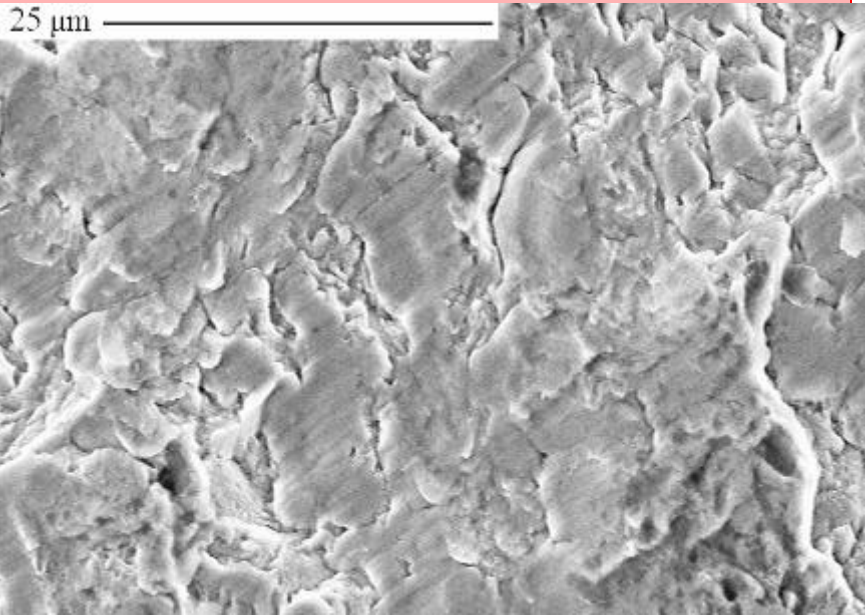
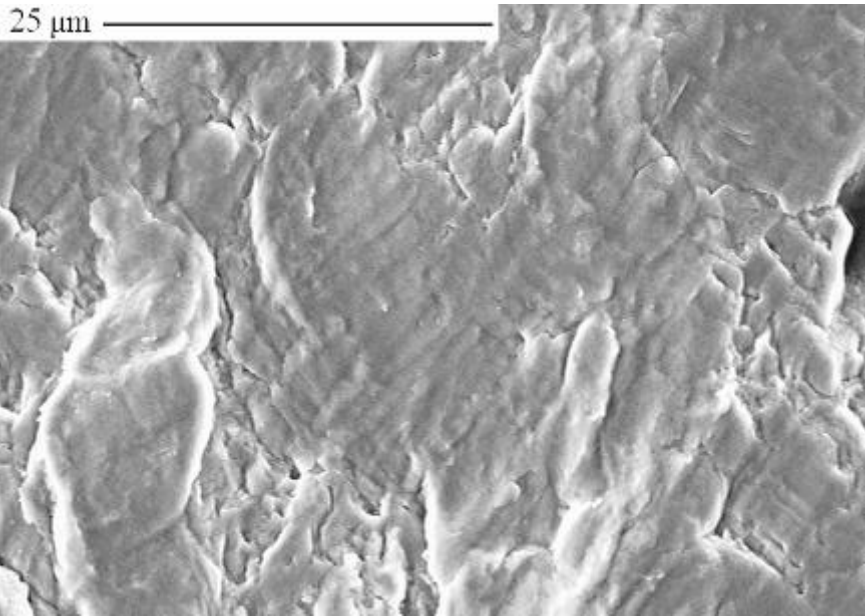


Fractography: overload areas



As-received

Re-heat-treated

Subsurface

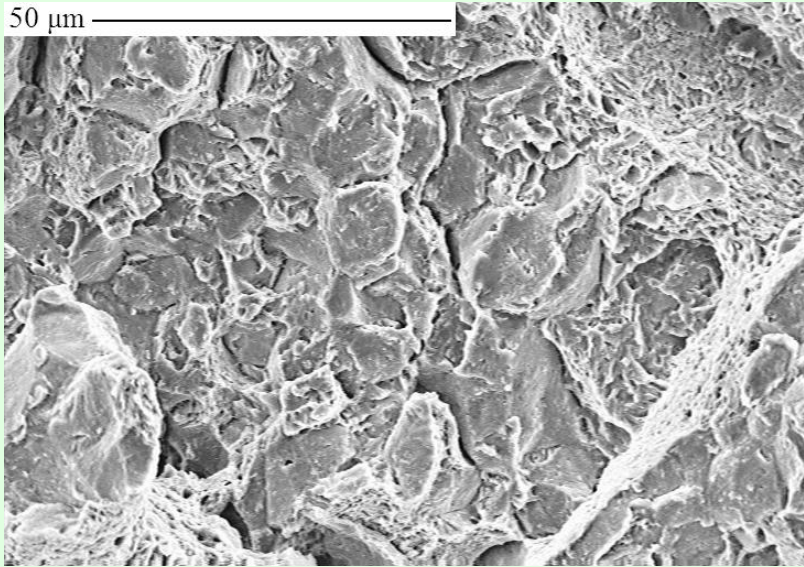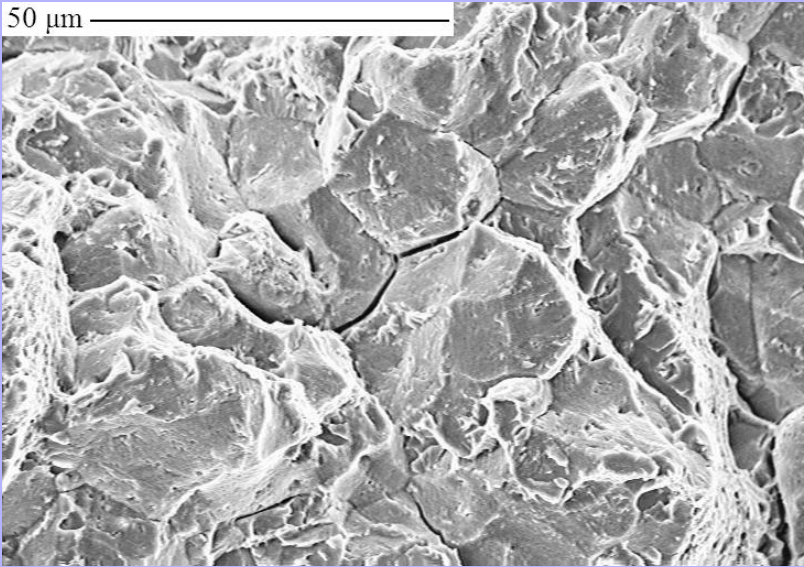

Close-to-core

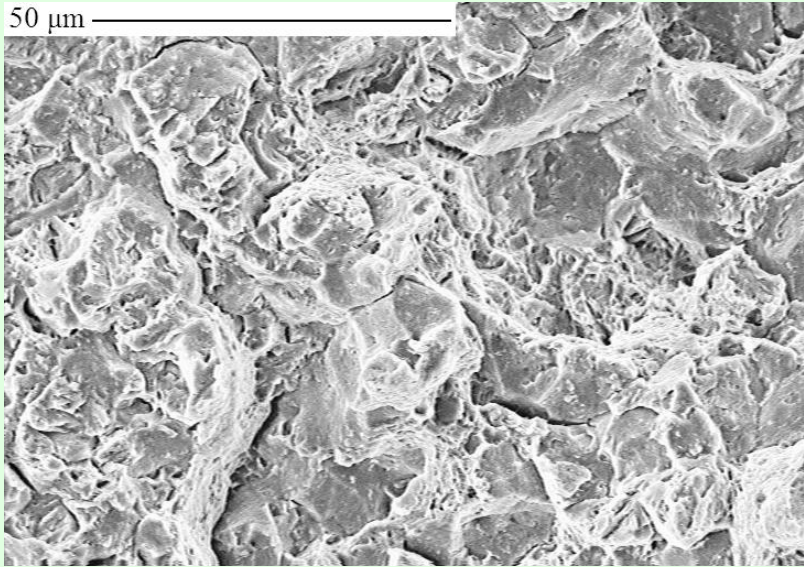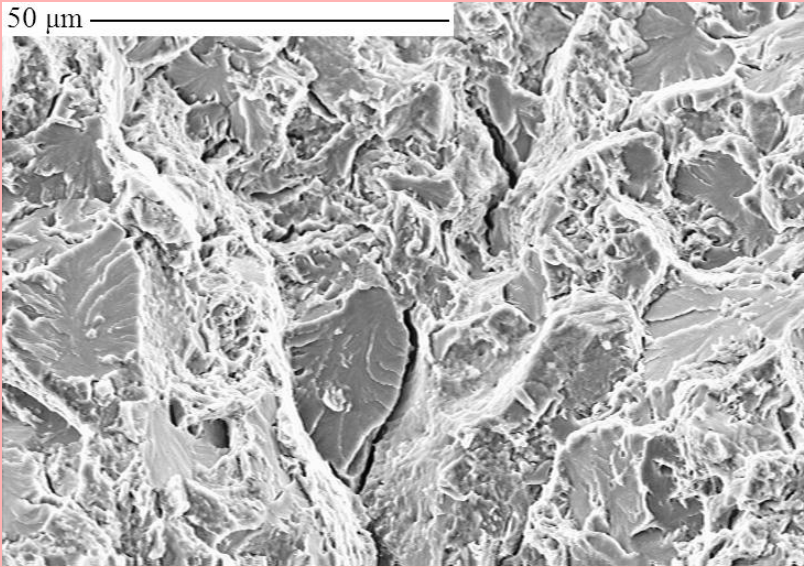

Conclusions

Mixed microstructures occur throughout a pre-hardened steel bloom for dies apt to large plastic components fabrication.

The fracture toughness is exceptionally low for a Q&T steel. At the tested depths, K_{Ic} values were 38 MPa \sqrt{m} ca. close to the bloom surface and 43 MPa \sqrt{m} ca. near the core.

The low toughness is attributed to the slack quench, due to the large molds dimensions (1x1x3 m).

Endurance limits were about 560 MPa for the steel close to the surface and 495 MPa for the steel near the core. They scale with the steel tensile strength, not with its fracture toughness.

Endurance limits for samples individually re-heat-treated increased 25%, keeping the differences due to the location.

This presentation was titled

**RELATION BETWEEN TOUGHNESS,
INFINITE FATIGUE LIFE AND
MICROSTRUCTURE IN LARGE BLOOMS FOR
AUTOMOTIVE PLASTIC MOLDS**

The authors were Italian

D. Firrao, P. Matteis, Politecnico di Torino

M.R. Pinasco, E. Stagno, Università di Genova

**R. Gerosa, B. Rivolta, G. Silva, Politecnico di
Milano**

A. Ghidini, Lucchini Sidermeccanica S.p.A.

..JUST IN CASE YOU WERE LATE

FOR INFORMATION

paolo.matteis@polito.it

Tel.: +39-011-5644711

Sorry, do not ask for me; sometimes I have
difficulty in finding myself

THANK YOU FOR YOUR
ATTENTION